

039/5003/AG/cc

23rd June 2025

Mr J Scott
Britology
jonathan@britology.co.uk



Registered in England 07068066

Parkhill
Wetherby
West Yorkshire
LS22 5DZ

T 01937 545 330
www.lithos.co.uk

Dear Jonathan

Lower Edge Quarry – gas & groundwater monitoring results

We have undertaken the eighth of 12 monthly gas monitoring visits and the sixth of 12 monthly groundwater sampling visit at Lower Edge Quarry to inform a landfill permit application, results of which are included in this letter.

This letter should be read in conjunction with the Factual Letter Report issued by Lithos on the 28th October 2024 (Ref. 017/5003/AG/cc) and the letter detailing the findings of the previous (seventh) monitoring visit (Ref. 038/5003/AG/cc), issued on the 7th June 2025.

Background

The site is located off Lower Edge Road, approximately 5.3km southeast of Halifax town centre and currently comprises an active quarry operated by Rand & Asquith. We understand the quarry is partially infilled with "stone, shale and pockets of fly ash", however, in places the existing quarry void is c. 20m deep.

Lithos supervised the drilling of 5 rotary openhole boreholes between the 7th and 15th October 2024, to allow for the installation of dual gas and groundwater monitoring wells around the perimeter of the site. A total of 12 monthly visits will be undertaken to aid the application of a landfill permit. Details of the monitoring wells are listed below.

Monitoring well	Coordinates		Level	Installation	Response zone depths m bgl (m AOD)	Response zone lithology
	easting	northing				
BH01	412845.1	421374.6	160.149	19mm HDPE pipe	1.0 – 3.0 (159.15 – 157.15)	Quarry Backfill
				50mm HDPE pipe	18.0 – 22.0 (142.15 – 138.15)	Quarry Backfill
BH02	412729.9	421182.0	172.376	19mm HDPE pipe	1.0 – 3.0 (171.38 – 169.38)	Elland Flags
				50mm HDPE pipe	18.0 – 22.0 (154.38 – 150.38)	Elland Flags
BH03	412813.4	421106.3	177.696	19mm HDPE pipe	1.0 – 3.0 (176.70 – 174.70)	Granular Residual Soils
				50mm HDPE pipe	28.0 – 32.0 (149.70 – 145.70)	Elland Flags
BH04	412940.4	421050.0	176.317	19mm HDPE pipe	1.0 – 3.0 (175.32 – 173.32)	Quarry Backfill
				50mm HDPE pipe	36.0 – 40.0 (140.32 – 136.32)	Possible Elland Flags
BH05	413013.5	421099.8	173.108	19mm HDPE pipe	1.0 – 3.0 (172.12 – 170.12)	Elland Flags
				50mm HDPE pipe	35.5 – 39.5 (137.61 – 133.61)	Elland Flags

Groundwater dip results

A total of eight groundwater visits have been undertaken to determine the level of groundwater within the boreholes.

Results of groundwater dips to date are summarised below:



Date	Visit	Well	Groundwater level m bgl	Remarks
31/10/24	Initial dip	BH01	19.23	-
07/11/24	Visit 1		20.30	Bailed 8 Litres to 21.34m bgl at 09:39. Re-dipped at 20.41m bgl at 14:45
04/12/24	Visit 2		17.93	-
06/01/25	Visit 3		ND	-
10/02/25	Visit 4		ND	-
05/03/25	Visit 5		ND	
08/04/25	Visit 6		ND	
13/05/25	Visit 7		ND	
02/06/25	Visit 8		ND	
31/10/24	Initial dip	BH02	20.68	-
07/11/24	Visit 1		20.82	Bailed 11 litres to 22.05m bgl at 10:00. Re-dipped at 22.05m bgl at 14:40
04/12/24	Visit 2		20.15	-
06/01/25	Visit 3		20.01	-
10/02/25	Visit 4		21.83	-
05/03/25	Visit 5		20.29	
08/04/25	Visit 6		20.48	
13/05/25	Visit 7		ND	
02/06/25	Visit 8		ND	
31/10/24	Initial dip	BH03	>30.00	-
07/11/24	Visit 1		32.33	Bailed 2 litres to 32.61m bgl at 10:21. Re-dipped at 32.61m bgl at 14:38
04/12/24	Visit 2		31.70	-
06/01/25	Visit 3		29.66	-
10/02/25	Visit 4		31.38	-
05/03/25	Visit 5		31.29	
08/04/25	Visit 6		31.26	
13/05/25	Visit 7		ND	
02/06/25	Visit 8		31.15	
31/10/24	Initial dip	BH04	>30.00	-
07/11/24	Visit 1		34.85	Bailed 33 litres to 37.49m bgl at 11:05. Re-dipped at 38.01m at 14:21.
04/12/24	Visit 2		31.11	-
13/01/25	Visit 3A		29.51	-
10/02/25	Visit 4		31.16	-
05/03/25	Visit 5		34.26	
08/04/25	Visit 6		35.13	
13/05/25	Visit 7		ND	
02/06/25	Visit 8		35.17	
31/10/24	Initial dip	BH05	28.66	-
07/11/24	Visit 1		29.08	Bailed 60 litres to 35.33m bgl at 14:15
04/12/24	Visit 2		27.00	-
13/01/25	Visit 3A		25.87	-
10/02/25	Visit 4		27.69	-
05/03/25	Visit 5		28.09	

Date	Visit	Well	Groundwater level m bgl	Remarks
08/04/25	Visit 6		28.90	
13/05/25	Visit 7		30.95	
02/06/25	Visit 8		29.23	

Groundwater sampling

Monthly groundwater samples are required to aid the landfill permit application. To date, six rounds of groundwater sampling have been undertaken.

On each visit, purging of groundwater was undertaken using 13mm low flow waterra tubing prior to sampling. On completion of sampling, water samples were kept in cold storage until being collected by the laboratory. Groundwater levels and field observations made by the engineer during the sixth sampling visit are summarised in the table below.

Monitoring well	Response zone (m)	Groundwater level (m bgl)	Depth to base (m)	Sampling method	Comments
BH01	18.0 – 22.0 (142.15 – 138.15)	ND	20.76	No sampling undertaken (well dry/low water levels)	-
BH02	18.0 – 22.0 (154.38 – 150.38)	ND	21.28		-
BH03	28.0 – 32.0 (149.70 – 145.70)	31.15	31.76		-
BH04	36.0 – 40.0 (140.32 – 136.32)	35.17	39.50	Low flow waterra	24 litres of water purged prior to sampling
BH05	35.5 – 39.5 (137.61 – 133.61)	29.23	37.50		40 litres of water purged prior to sampling.

There was insufficient water in BHs 01 to 03 during visit 6 to obtain a representative water sample.

Laboratory testing

Two samples of groundwater (BH04 & BH05) were sent to a UKAS accredited laboratory for analysis. Each sample was scheduled for a suite including:

- Metals (As, Cd, Cr, Cu, Pb, Hg, Ni, Se, Zn & B)
- Chloride
- Ammoniacal nitrogen
- Conductivity
- Dissolved organic carbon
- pH
- Total phenol
- Speciated TPH
- Speciated PAH

Laboratory results are appended to this letter and summarised in the Table on page 5. Lithos does not hold information regarding the critical concentrations, and therefore no values have been included.

Gas monitoring results

A standard procedure was followed in accordance with CIRIA guidance; this procedure involved measurement, in the following order of:

- Atmospheric temperature, pressure and ambient oxygen concentration on site immediately prior to and on completion of monitoring
- Methane, oxygen and carbon dioxide concentrations and flow rates using a Gas Data GFM436 infra-red gas analyser
- Standing water level using a dipmeter

To date, eight monthly gas monitoring visits have been undertaken. The monitoring results from visit 8 of 12 are enclosed and summarised in the table below.

Well		Response zone	Range of methane concentrations (% v/v)	Range of carbon dioxide concentrations (% v/v)	Range of steady flow rates (litre/hour)
BH01	50mm	Quarry backfill	ND	0.2	ND
	19mm	Quarry backfill	ND	0.4	ND
BH02	50mm	Elland Flags	ND	0.3	ND
	19mm	Elland Flags	ND	0.3	ND
BH03	50mm	Granular Residual Soils	ND	0.1	ND
	19mm	Elland Flags	ND	1.0	ND
BH04	50mm	Quarry backfill	ND	0.2	ND
	19mm	Possible Elland Flags	ND	0.4	0.3
BH05	50mm	Elland Flags	ND	0.8	ND
	19mm	Elland Flags	ND	0.2	ND

Note: Atmospheric pressures varied between 1007mb and 1035mb. ND – None detected.

During the visit on the 2nd June atmospheric pressure was rising from 992 to 1020 across the day.

Should you require any further information, please contact the undersigned.

Yours sincerely



Adam Gombocz
Director
for and on behalf of
LITHOS CONSULTING LIMITED

Encl.

Gas & Groundwater monitoring data – visit 8
Drawing 5003/6 BH location plan
Borehole logs
Chemical test results

SUMMARY OF GROUNDWATER TESTING – VISIT 8

Expl Hole	pH	As	B	Cd	Cr	Cu	Pb	Hg	Ni	Se	Zn	Cl ⁻	Ammoniacal N	Conductivity	Dissolved Organic Carbon	Total Phenol	PAHs	TPH
		ug/l	ug/l	ug/l	ug/l	ug/l	ug/l	ug/l	ug/l	ug/l	ug/l	mg/l	mg/l	uS/cm	mg/l	ug/l	ug/l	C ₁ – C ₄₀
BH04	6.8	0.45	522.8	0.04	0.35	1.7	<0.09	<0.01	1.9	7.2	36	58	<0.015	1570	5.2	<5.0	4.4	<10
BH05	7.1	0.59	544.5	0.04	7.8	2.3	3.5	<0.01	1.9	7.9	17	66	<0.015	1590	3.1	<5.0	1.0	<10

Visit 8

Job Title:										Job No:	
Quarry at Rastrick, Brighouse										5003	
Client:										Sheet :	
Britology										8 of 8	
Date:		Arrival Time:		Depart Time:		Operator:					
02/06/2025		08:00		10:00		George Costley & Charlotte Copley					



Gas Monitoring Results:										
Ambient Concentration (% Volume):		CH ₄ :	ND	CO ₂ :	ND	O ₂ :	21.1			

Monitoring Point	Groundwater level	Concentrations					Gas Flow Rates			Bottom of well	Remarks
		Initial / Highest		Steady concentrations		Lowest concn	Initial / Maximum	Steady	Time to fall from highest to steady		
		CH ₄	CO ₂	CH ₄	CO ₂	O ₂					
		% v/v	(%)	% v/v	(%)	(%)					
(m) bgl						litre/hr	litre/hr	secs	m		
BH01 (50mm)	ND	ND	0.2	ND	0.2	20.1	ND	ND	120.0	20.57	
BH02 (50mm)	ND	ND	0.3	ND	0.3	20.7	ND	ND	120.0	22.12	
BH03 (50mm)	31.15	ND	0.1	ND	0.1	20.9	1.9	ND	120.0	31.65	
BH04 (50mm)	35.17	ND	0.2	ND	0.2	20.8	ND	ND	120.0	39.53	
BH05 (50mm)	29.23	ND	0.8	ND	0.8	14.1	ND	ND	120.0	37.44	
BH01 (19mm)	ND	ND	0.4	ND	0.4	20.7	ND	ND	120.0	2.79	
BH02 (19mm)	ND	ND	0.3	ND	0.3	20.6	ND	ND	120.0	2.72	
BH03 (19mm)	ND	ND	1.0	ND	1.0	20.4	ND	ND	120.0	2.88	
BH04 (19mm)	ND	ND	0.4	ND	0.4	20.6	ND	ND	120.0	2.55	
BH05 (19mm)	ND	ND	0.2	ND	0.2	20.9	ND	ND	120.0	2.71	

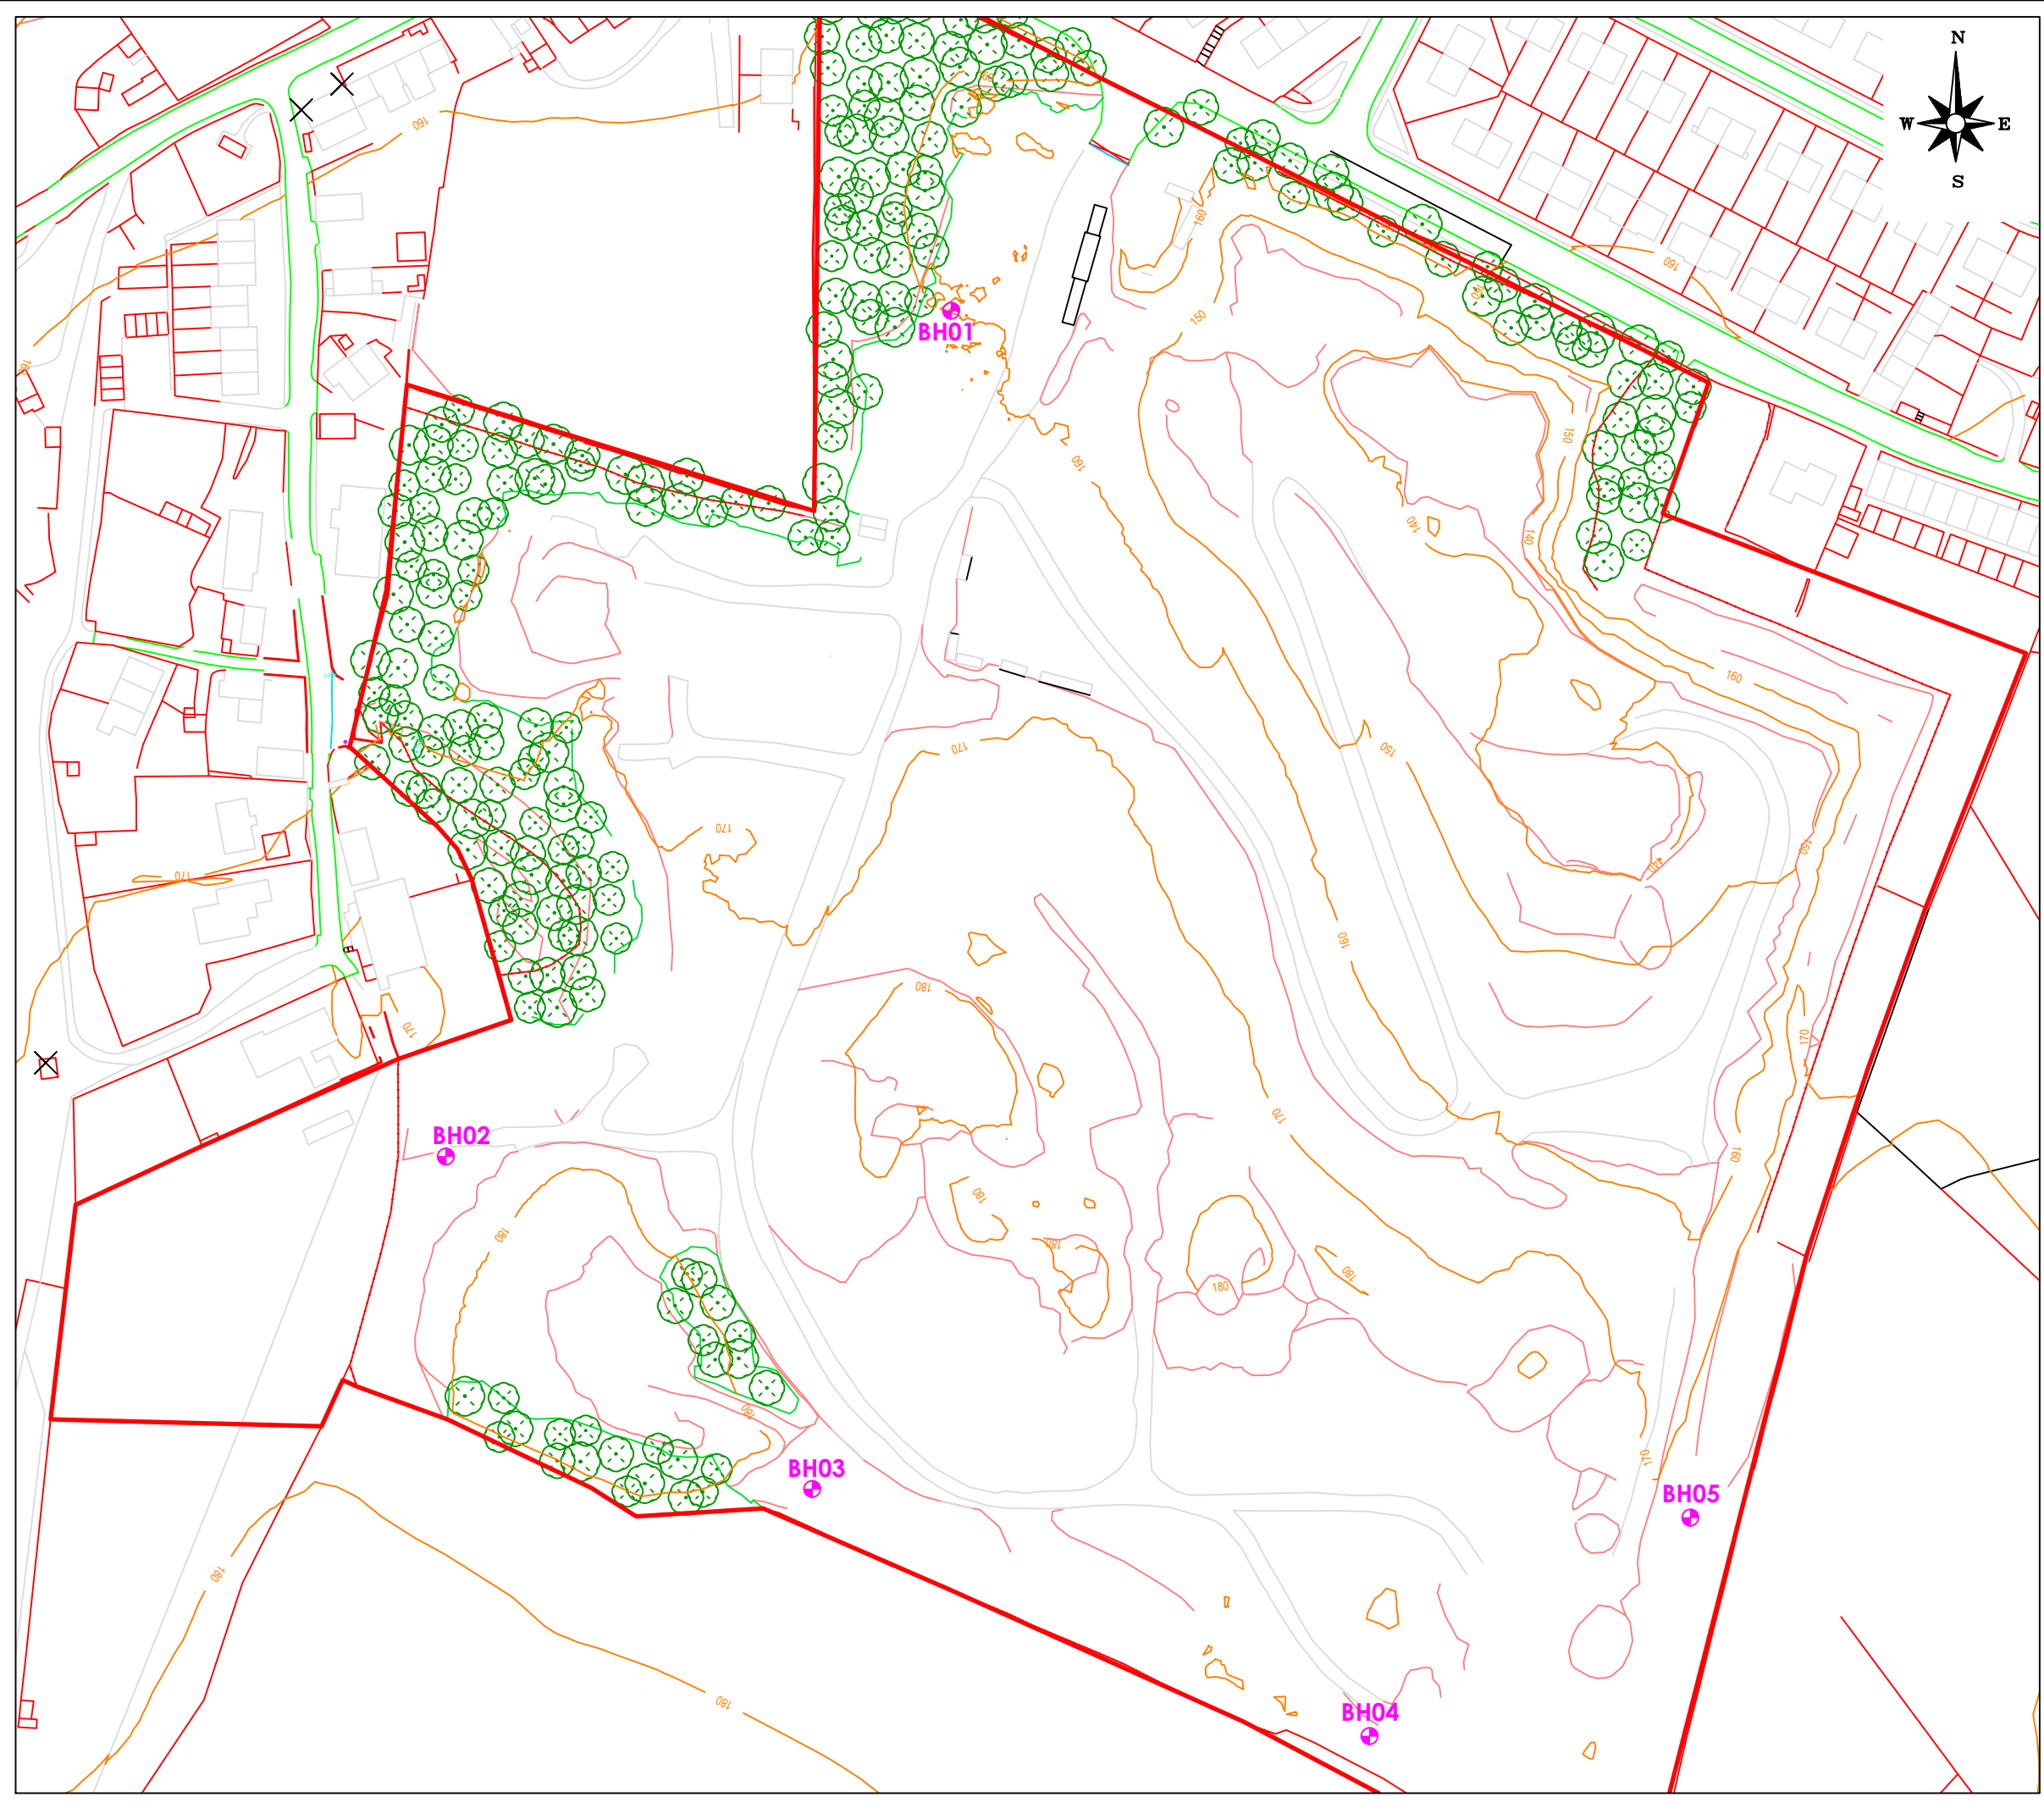
Equipment Used:				Next Calibration Date				Key							
Gas Data GFM436 Infrared Gas Analyser				04/03/2026				ND				None Detected			
Geotechnical Instruments Dipmeter								NR				Not Recorded			
								1.0				Recorded value does not breach trigger levels			
								5.0				Recorded value breaches trigger level 1			
								10.0				Recorded value breaches trigger level 2			

	Site Data:			Weather Station Data (Ganton Weather Station)						Trigger level 1	CH ₄	CO ₂	O ₂	
	Temp (°C):	12.6 > 16.2		Barometric Pressure Trend:			Rising							
Time:	08:00	09:00	10:00	00:00	06:00	08:00	09:00	10:00	12:00					
Pressure (mb):	992	992	994	1016	1018	1020	1020	1020	1020	Trigger level 2	5.0	10.0	10.0	

	Weather Conditions:		Sunny, Cool											
	Surface Ground Conditions:		Dry											

Remarks:

Ganton Weather station is located approximately 2 miles south from the site (Quarry at Rastrick, Brighouse)



NOTES

 BOREHOLE LOCATION

 APPROXIMATE SITE BOUNDARY

EXPLORATORY HOLE LOCATIONS HAVE BEEN SURVEYED
IN (COORDINATES & GROUND LEVEL) ON COMPLETION

REV.	DESCRIPTION	DATE



info@lithos.co.uk
www.lithos.co.uk
Tel 01937 545330

CLIENT

BRITOLOGY

JOB TITLE



QUARRY NEAR
RASTRICK,
BRIGHOUSE



DRAWING TITLE




EXPLORATORY HOLE LOCATIONS

DRAWN	LEW	DATE	16 10 2025	STATUS	FOR COMMENT ☐
CHECKED	AG	DATE	16 10 2025	FOR APPROVAL	☐
				DRAFT	☐
				FINAL	☒

SCALE	1:1500	SHEET	A3	DRAWING NO.	5003/6	REVISION	
-------	--------	-------	----	-------------	--------	----------	--

					Borehole Log			Borehole No. BH01 Sheet 1 of 2					
Project Name: Quarry at Rastrick					Project No. 5003		Co-ords: 412845.06 - 421374.61		Hole Type PH				
Location: Rastrick					Level: 160.15		Scale 1:100		Logged By CC				
Client: Britology					Dates: 15/10/2024 - 15/10/2024								
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description					
		Depth (m)	Type	Results									
								MADE GROUND: Light brown QUARRY BACKFILL. Recovered as sandstone with occasional flecks of mudstone. (QUARRY BACKFILL)					
		Continued on next sheet											
Remarks 1. Prior to drilling a Cable Avoidance Tool (CAT) survey was carried out. 2. Groundwater was not encountered. 3. Exploratory hole surveyed in (level and co-ordinates) on completion.													

					Borehole Log			Borehole No. BH01 Sheet 2 of 2			
Project Name: Quarry at Rastrick					Project No. 5003		Co-ords: 412845.06 - 421374.61		Hole Type PH		
Location: Rastrick					Level: 160.15		Scale 1:100		Logged By CC		
Client: Britology					Dates: 15/10/2024 - 15/10/2024						
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description			
		Depth (m)	Type	Results							
					22.00	138.15		End of borehole at 22.00 m	21		
									22		
									23		
									24		
									25		
									26		
									27		
									28		
									29		
									30		
									31		
									32		
									33		
									34		
									35		
									36		
									37		
									38		
									39		
									40		
Remarks 1. Prior to drilling a Cable Avoidance Tool (CAT) survey was carried out. 2. Groundwater was not encountered. 3. Exploratory hole surveyed in (level and co-ordinates) on completion.											





				Borehole Log				Borehole No. BH02 Sheet 1 of 2		
Project Name: Quarry at Rastrick				Project No. 5003		Co-ords: 412729.92 - 421181.99		Hole Type PH		
Location: Rastrick						Level: 172.40		Scale 1:100		
Client: Britology						Dates: 07/10/2024 - 07/10/2024		Logged By CC		
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description		
		Depth (m)	Type	Results						
					1.50	170.90		Overburden. (GRANULAR RESIDUAL SOIL)	1	
									Light brown SANDSTONE. (ELLAND FLAGS)	2
										3
										4
										5
										6
						7.00	165.40		Interbedded SANDSTONE and MUDSTONE. (ELLAND FLAGS)	7
						8.40	164.00		Light brown SANDSTONE. (ELLAND FLAGS)	8
										9
										10
								11		
								12		
								13		
								14		
								15		
								16		
								17		
								18		
								19		
								20		


Continued on next sheet



Remarks


1. Prior to drilling a Cable Avoidance Tool (CAT) survey was carried out. 2. Groundwater encountered between 17.3m and 20.3m depth. 3. Flush returns were lost from 12.4m and 15.4m depth. 4. Exploratory hole surveyed in (level and co-ordinates) on completion.








					Borehole Log			Borehole No. BH02 Sheet 2 of 2	
Project Name: Quarry at Rastrick					Project No. 5003		Co-ords: 412729.92 - 421181.99		Hole Type PH
Location: Rastrick					Level: 172.40		Scale 1:100		Logged By CC
Client: Britology					Dates: 07/10/2024 - 07/10/2024				
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
		Depth (m)	Type	Results					
					22.00	150.40		Dark grey MUDSTONE. (ELLAND FLAGS)	21
					26.00	146.40		End of borehole at 26.00 m	23
									25
									27
									29
									31
									33
									35
									37
									39
Remarks 1. Prior to drilling a Cable Avoidance Tool (CAT) survey was carried out. 2. Groundwater encountered between 17.3m and 20.3m depth. 3. Flush returns were lost from 12.4m and 15.4m depth. 4. Exploratory hole surveyed in (level and co-ordinates) on completion.									

					Borehole Log			Borehole No. BH03 Sheet 1 of 2				
Project Name: Quarry at Rastrick					Project No. 5003		Co-ords: 412813.40 - 421106.28		Hole Type PH			
Location: Rastrick					Level: 177.70		Scale 1:100		Logged By CC			
Client: Britology					Dates: 08/10/2024 - 09/10/2024							
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description				
		Depth (m)	Type	Results								
					6.50	171.20		Overbuden. (GRANULAR RESIDUAL SOIL)	1			
									2			
												3
												4
												5
												6
												7
												8
												9
												10
												11
												12
												13
												14
												15
												16
												17
												18
												19
												20
Continued on next sheet												
Remarks 1. Prior to drilling a Cable Avoidance Tool (CAT) survey was carried out. 2. Groundwater was not encountered. 3. Exploratory hole surveyed in (level and co-ordinates) on completion.												

					Borehole Log			Borehole No. BH03 Sheet 2 of 2			
Project Name: Quarry at Rastrick					Project No. 5003		Co-ords: 412813.40 - 421106.28		Hole Type PH		
Location: Rastrick					Level: 177.70		Scale 1:100		Logged By CC		
Client: Britology					Dates: 08/10/2024 - 09/10/2024						
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description			
		Depth (m)	Type	Results							
									21		
									22		
									23		
									24		
									25		
					26.00	151.70		Dark grey MUDSTONE. (ELLAND FLAGS)	26		
					27.00	150.70		Interbedded SANDSTONE and MUDSTONE. (ELLAND FLAGS)	27		
									28		
									29		
									30		
					31.00	146.70		Dark grey MUDSTONE. (ELLAND FLAGS)	31		
									32		
					32.40	145.30		End of borehole at 32.40 m	33		
									34		
									35		
									36		
									37		
									38		
									39		
									40		
Remarks 1. Prior to drilling a Cable Avoidance Tool (CAT) survey was carried out. 2. Groundwater was not encountered. 3. Exploratory hole surveyed in (level and co-ordinates) on completion.											

					Borehole Log			Borehole No. BH04 Sheet 1 of 3			
Project Name: Quarry at Rastrick					Project No. 5003		Co-ords: 412940.37 - 421050.00		Hole Type PH		
Location: Rastrick					Level: 176.30		Scale 1:100		Logged By CC		
Client: Britology					Dates: 10/10/2024 - 10/10/2024						
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description			
		Depth (m)	Type	Results							
								MADE GROUND: Light brown QUARRY BACKFILL. Recovered as a light brown sandstone with occasional bands of dark grey mudstone. (QUARRY BACKFILL)	1		
									2		
									3		
									4		
									5		
									6		
									7		
									8		
									9		
									10		
									11		
									12		
									13		
									14		
									15		
									16		
									17		
									18		
									19		
									20		
Continued on next sheet											
Remarks 1. Prior to drilling a Cable Avoidance Tool (CAT) survey was carried out. 2. Groundwater was not encountered. 3. Flush returns were lost from 40.0m and 44.5m depth. 4. Exploratory hole surveyed in (level and co-ordinates) on completion.											

					Borehole Log			Borehole No. BH04 Sheet 2 of 3			
Project Name: Quarry at Rastrick					Project No. 5003		Co-ords: 412940.37 - 421050.00		Hole Type PH		
Location: Rastrick					Level: 176.30		Scale 1:100		Logged By CC		
Client: Britology					Dates: 10/10/2024 - 10/10/2024						
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description			
		Depth (m)	Type	Results							
								)	21		
									22		
									23		
									24		
									25		
									26		
									27		
									28		
									29		
									30		
									31		
									32		
									33		
									34		
									35		
									36		
									37		
									38		
									39		
					40.00	136.30				40	
	Continued on next sheet										
Remarks 1. Prior to drilling a Cable Avoidance Tool (CAT) survey was carried out. 2. Groundwater was not encountered. 3. Flush returns were lost from 40.0m and 44.5m depth. 4. Exploratory hole surveyed in (level and co-ordinates) on completion.											

					Borehole Log			Borehole No. BH05 Sheet 1 of 2			
Project Name: Quarry at Rastrick					Project No. 5003		Co-ords: 413013.46 - 421099.76		Hole Type PH		
Location: Rastrick					Level: 173.10		Scale 1:100		Logged By CC		
Client: Britology					Dates: 14/10/2024 - 14/10/2024						
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description			
		Depth (m)	Type	Results							
					6.00	167.10		Light brown SANDSTONE. (ELLAND FLAGS)		1	
										2	
										3	
										4	
										5	
										6	
								Dark grey MUDSTONE. (ELLAND FLAGS)		7	
										8	
										9	
										10	
										11	
								Light brown SANDSTONE. (ELLAND FLAGS)		12	
										13	
										14	
										15	
								Dark grey MUDSTONE. (ELLAND FLAGS)		16	
										17	
										18	
										19	
										20	
Continued on next sheet											
Remarks 1. Prior to drilling a Cable Avoidance Tool (CAT) survey was carried out. 2. Groundwater was not encountered. 3. Exploratory hole surveyed in (level and co-ordinates) on completion.											

LITHOS CONSULTING					Borehole Log			Borehole No. BH05 Sheet 2 of 2										
Project Name: Quarry at Rastrick					Project No. 5003		Co-ords: 413013.46 - 421099.76		Hole Type PH									
Location: Rastrick					Level: 173.10		Scale 1:100		Logged By CC									
Client: Britology					Dates: 14/10/2024 - 14/10/2024													
Well	Water Strikes	Samples and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description										
		Depth (m)	Type	Results														
					21.50	151.60		Light brown SANDSTONE. (ELLAND FLAGS)	21									
									22									
									23									
									24									
									25									
									26									
									27									
									28									
									29									
									30									
					35.50	137.60		Dark grey MUDSTONE. (ELLAND FLAGS)	35									
									36									
									37									
									38									
									39									
									40									
														37.00	136.10		Interbedded SANDSTONE and MUDSTONE. (ELLAND FLAGS)	37
																		38
																		39
																		40
					38.50	134.60		Dark grey MUDSTONE. (ELLAND FLAGS)	38									
									39									
									40									
									40									
					39.50	133.60		End of borehole at 39.50 m	39									
									40									
									40									
									40									
Remarks 1. Prior to drilling a Cable Avoidance Tool (CAT) survey was carried out. 2. Groundwater was not encountered. 3. Exploratory hole surveyed in (level and co-ordinates) on completion.																		

Certificate of Analysis

Certificate Number 25-12309

Issued: 17-Jun-25

Client Lithos Consulting Ltd
Parkhill
Walton Rd
Wetherby
LS22 5DZ

Our Reference 25-12309

Client Reference ~ 5003

Order No ~ PO24314

Contract Title ~ Lower Edge Quarry

Description 2 Groundwater samples.

Date Received 03-Jun-25

Date Started 03-Jun-25

Date Completed 17-Jun-25

Test Procedures Identified by prefix DETSn (details on request).

Notes Opinions and interpretations are outside the laboratory's scope of ISO 17025 accreditation. This certificate is issued in accordance with the accreditation requirements of the United Kingdom Accreditation Service. The results reported herein relate only to the material supplied to the laboratory. This certificate shall not be reproduced except in full, without the prior written approval of the laboratory.

Approved By

A handwritten signature in black ink, appearing to read "Adam Geddes".

Adam Geddes
Laboratory Manager



Summary of Chemical Analysis

Water Samples

Our Ref 25-12309

Client Ref ~ 5003

Contract Title ~ Lower Edge Quarry

Lab No	2517403	2517404
Sample ID ~	BH04	BH05
Depth ~		
Other ID ~		
Sample Type ~	GROUND WATER	GROUND WATER
Sampling Date ~	02/06/2025	02/06/2025
Sampling Time ~	n/s	n/s

Test	Method	LOD	Units		
Metals					
Arsenic, Dissolved	DETSC 2306	0.16	ug/l	0.45	0.59
Boron, Dissolved	DETSC 2306*	12	ug/l	522.8	544.5
Cadmium, Dissolved	DETSC 2306	0.03	ug/l	0.04	0.04
Chromium, Dissolved	DETSC 2306	0.25	ug/l	0.35	7.8
Copper, Dissolved	DETSC 2306	0.4	ug/l	1.7	2.3
Lead, Dissolved	DETSC 2306	0.09	ug/l	< 0.09	3.5
Mercury, Dissolved	DETSC 2306	0.01	ug/l	< 0.01	< 0.01
Nickel, Dissolved	DETSC 2306	0.5	ug/l	1.9	1.9
Selenium, Dissolved	DETSC 2306	0.25	ug/l	7.2	7.9
Zinc, Dissolved	DETSC 2306	1.3	ug/l	36	17
Inorganics					
Conductivity (25oC)	DETSC 2009	1	uS/cm	1570	1590
pH	DETSC 2008		pH	6.8	7.1
Dissolved Organic Carbon	DETSC 2085	2	mg/l	5.2	3.1
Ammoniacal Nitrogen as N	DETSC 2207	0.015	mg/l	< 0.015	< 0.015
Chloride	DETSC 2055	0.1	mg/l	58	66
Petroleum Hydrocarbons					
Aliphatic C5-C6	DETSC 3322	0.1	ug/l	< 0.1	< 0.1
Aliphatic C6-C8	DETSC 3322	0.1	ug/l	< 0.1	< 0.1
Aliphatic C8-C10	DETSC 3322	0.1	ug/l	< 0.1	< 0.1
Aliphatic C10-C12	DETSC 3072*	1	ug/l	< 1.0	< 1.0
Aliphatic C12-C16	DETSC 3072*	1	ug/l	< 1.0	< 1.0
Aliphatic C16-C21	DETSC 3072*	1	ug/l	< 1.0	< 1.0
Aliphatic C21-C35	DETSC 3072*	1	ug/l	< 1.0	< 1.0
Aliphatic C5-C35	DETSC 3072*	10	ug/l	< 10	< 10
Aromatic C5-C7	DETSC 3322	0.1	ug/l	< 0.1	< 0.1
Aromatic C7-C8	DETSC 3322	0.1	ug/l	< 0.1	< 0.1
Aromatic C8-C10	DETSC 3322	0.1	ug/l	< 0.1	< 0.1
Aromatic C10-C12	DETSC 3072*	1	ug/l	< 1.0	< 1.0
Aromatic C12-C16	DETSC 3072*	1	ug/l	< 1.0	< 1.0
Aromatic C16-C21	DETSC 3072*	1	ug/l	< 1.0	< 1.0
Aromatic C21-C35	DETSC 3072*	1	ug/l	< 1.0	< 1.0
Aromatic C5-C35	DETSC 3072*	10	ug/l	< 10	< 10
TPH Ali/Aro Total C5-C35	DETSC 3072*	10	ug/l	< 10	< 10
PAHs					
Naphthalene	DETSC 3304	0.05	ug/l	0.28	0.09
Acenaphthylene	DETSC 3304	0.01	ug/l	0.08	0.02
Acenaphthene	DETSC 3304	0.01	ug/l	0.06	0.02
Fluorene	DETSC 3304	0.01	ug/l	0.09	0.02
Phenanthrene	DETSC 3304	0.01	ug/l	0.58	0.14
Anthracene	DETSC 3304	0.01	ug/l	0.07	0.03

Summary of Chemical Analysis Water Samples

Our Ref 25-12309

Client Ref ~ 5003

Contract Title ~ Lower Edge Quarry

Lab No	2517403	2517404
Sample ID ~	BH04	BH05
Depth ~		
Other ID ~		
Sample Type ~	GROUND WATER	GROUND WATER
Sampling Date ~	02/06/2025	02/06/2025
Sampling Time ~	n/s	n/s

Test	Method	LOD	Units		
Fluoranthene	DETSC 3304	0.01	ug/l	0.65	0.15
Pyrene	DETSC 3304	0.01	ug/l	0.64	0.16
Benzo(a)anthracene	DETSC 3304	0.01	ug/l	0.19	0.05
Chrysene	DETSC 3304	0.01	ug/l	0.37	0.09
Benzo(b)fluoranthene	DETSC 3304	0.01	ug/l	0.33	0.08
Benzo(k)fluoranthene	DETSC 3304	0.01	ug/l	0.11	0.02
Benzo(a)pyrene	DETSC 3304	0.01	ug/l	0.23	0.05
Indeno(1,2,3-c,d)pyrene	DETSC 3304	0.01	ug/l	0.33	0.07
Dibenzo(a,h)anthracene	DETSC 3304	0.01	ug/l	0.06	< 0.01
Benzo(g,h,i)perylene	DETSC 3304	0.01	ug/l	0.30	0.06
PAH Total	DETSC 3304	0.2	ug/l	4.4	1.0
Phenols					
Total Phenol	DETSC 3451*	0.5	ug/l	< 5.00	< 5.00

Information in Support of the Analytical Results

Our Ref 25-12309

Client Ref ~ 5003

Contract ~ Lower Edge Quarry

Containers Received & Deviating Samples

Lab No	Sample ID ~	Date Sampled ~	Containers Received	Holding time exceeded for tests	Incorrect container for tests
2517403	BH04 GROUND WATER	02/06/25	GB 1L, GV, PB 1L		
2517404	BH05 GROUND WATER	02/06/25	GB 1L, GV, PB 1L		

Key: G-Glass P-Plastic B-Bottle V-Vial

Normec DETS cannot be held responsible for the integrity of samples received whereby the laboratory did not undertake the sampling. In this instance samples received may be deviating. Deviating Sample criteria are based on British and International standards and laboratory trials in conjunction with the UKAS note 'Guidance on Deviating Samples'. All samples received are listed above. However, those samples that have additional comments in relation to hold time, inappropriate containers etc are deviating due to the reasons stated. This means that the analysis is accredited where applicable, but results may be compromised due to sample deviations. If no sampled date (soils) or date+time (waters) has been supplied then samples are deviating. However, if you are able to supply a sampled date (and time for waters) this will prevent samples being reported as deviating where specific hold times are not exceeded and where the container supplied is suitable.

Disposal

From the issue date of this test certificate, samples will be held for the following times prior to disposal :-
Soils - 1 month, Liquids - 2 weeks, Asbestos (test portion) - 6 months

Key:

~ Sample details are provided by the client and can affect the validity of the results

* -not accredited.

-MCERTS (accreditation only applies if report carries the MCERTS logo).

\$ -subcontracted.

n/s -not supplied.

I/S -insufficient sample.

U/S -unsuitable sample.

t/f -to follow.

nd -not detected.

End of Report Ver 25.03.06