

TONY BEDFORD

Site Investigation Drilling Specialist
11 Marconi Drive, Yaxley, Peterborough PE7 3ZR
Tel: 01733 242866 Mobile: 07860 514387

18

SITE NAME, ADDRESS, JOB NUMBER

BOREHOLE NO.

M T W Th F S Su 19 9 13

CRIMPISHAM

A

DISTURBED SAMPLES U4

UNDISTURBED SAMPLES U4

PENETRATION TESTS

SPT SPT W C

GROUND CONDITIONS ENCOUNTERED

| from | to | consistency or density / colour / type |
|-------|------|--|
| CL | 7.5 | BROWN SAND & FLINTY GRAVEL 19-9-12 |
| 7.5 | 9.8 | BROWN FLINTY SAND & GRAVEL |
| 9.8 | 10.5 | VERY FLINTY SAND & GRAVEL |
| 10.5 | 12.8 | BROWN FLINTY SAND & GRAVEL |
| 12.8 | 15.0 | Grey CLAY |
| 1 1/2 | | MOUND FORMING WATER FOR DRILLING |

| no. | depth |
|------|-------|
| D 1 | |
| D 2 | |
| D 3 | |
| D 4 | |
| D 5 | |
| D 6 | |
| D 7 | |
| D 8 | |
| D 9 | |
| D 10 | |
| D 11 | |
| D 12 | |
| D 13 | |
| D 14 | |
| D 15 | |
| D 16 | |
| D 17 | |
| D 18 | |
| D 19 | |
| D 20 | |

| no. | depth | length | blows |
|------|-------|--------|-------|
| U 1 | | | |
| U 2 | | | |
| U 3 | | | |
| U 4 | | | |
| U 5 | | | |
| U 6 | | | |
| U 7 | | | |
| U 8 | | | |
| U 9 | | | |
| U 10 | | | |
| U 11 | | | |
| U 12 | | | |
| U 13 | | | |
| U 14 | | | |
| U 15 | | | |

| type/no | depth | 150 | 75 | 75 | 75 | 75 |
|---------|-------|-----|----|----|----|----|
| S/C 1 | | | | | | |
| S/C 2 | | | | | | |
| S/C 3 | | | | | | |
| S/C 4 | | | | | | |
| S/C 5 | | | | | | |
| S/C 6 | | | | | | |
| S/C 7 | | | | | | |
| S/C 8 | | | | | | |
| S/C 9 | | | | | | |
| S/C 10 | | | | | | |
| S/C 11 | | | | | | |
| S/C 12 | | | | | | |
| S/C 13 | | | | | | |
| S/C 14 | | | | | | |
| S/C 15 | | | | | | |

BULK SAMPLES

| no. | from | to |
|------|------|----|
| B 1 | | |
| B 2 | | |
| B 3 | | |
| B 4 | | |
| B 5 | | |
| B 6 | | |
| B 7 | | |
| B 8 | | |
| B 9 | | |
| B 10 | | |
| B 11 | | |

DETAILS OF GROUNDWATER ENCOUNTERED

| | | | |
|---------------------------------|-----------|---|---|
| depth struck | 11.9 | | |
| casing depth | 11.5 | | |
| inflow rate | slow | | |
| rose to | 11.2 | | |
| sealed out at | 12.8 | | |
| sample no. | w | w | w |
| sample depth | no sample | | |
| water level at start of boring | Den | | |
| water level at finish of boring | 6.9 | | |
| water level when casing removed | 14.2 | | |

CHISEL OR PIT

| | | |
|-------------------------|-------|------|
| Borehole complete | Yes | No |
| Depth of borehole cased | 13.0 | |
| Piezometer (Standpipe?) | depth | 15.0 |

| | | | |
|-------|------|-----|------|
| from | 9.8 | CL | 10.1 |
| to | 10.0 | 1.2 | 10.2 |
| hours | 1 | 1 | 1/2 |

DRILLERS COMMENTS

DETAILS OF WATER ADDED

| | | | |
|--------|------|---|-------|
| from | 1.5 | | |
| to | 12.8 | | |
| litres | 100 | 4 | CLAYS |

| | | | |
|--------|------|---|-------|
| from | 1.5 | | |
| to | 12.8 | | |
| litres | 100 | 4 | CLAYS |

driller: K Davy



18-9-12

STANDPIPE INSTALLATION

SITE CRIMPLE SHAN

DATE 19-01-18

DRILLER KIDANEH

BOREHOLE No. A

T. BEDFORD

Site Investigation Drilling Specialist

11 Marconi Drive

Yaxley

Peterborough

PE7 3ZR


Tel: (01733) 242866

Fax: (01733) 242496

VAT No: 396/0636/26

tony.bedford@tesco.net

www.tbedforddrilling.co.uk

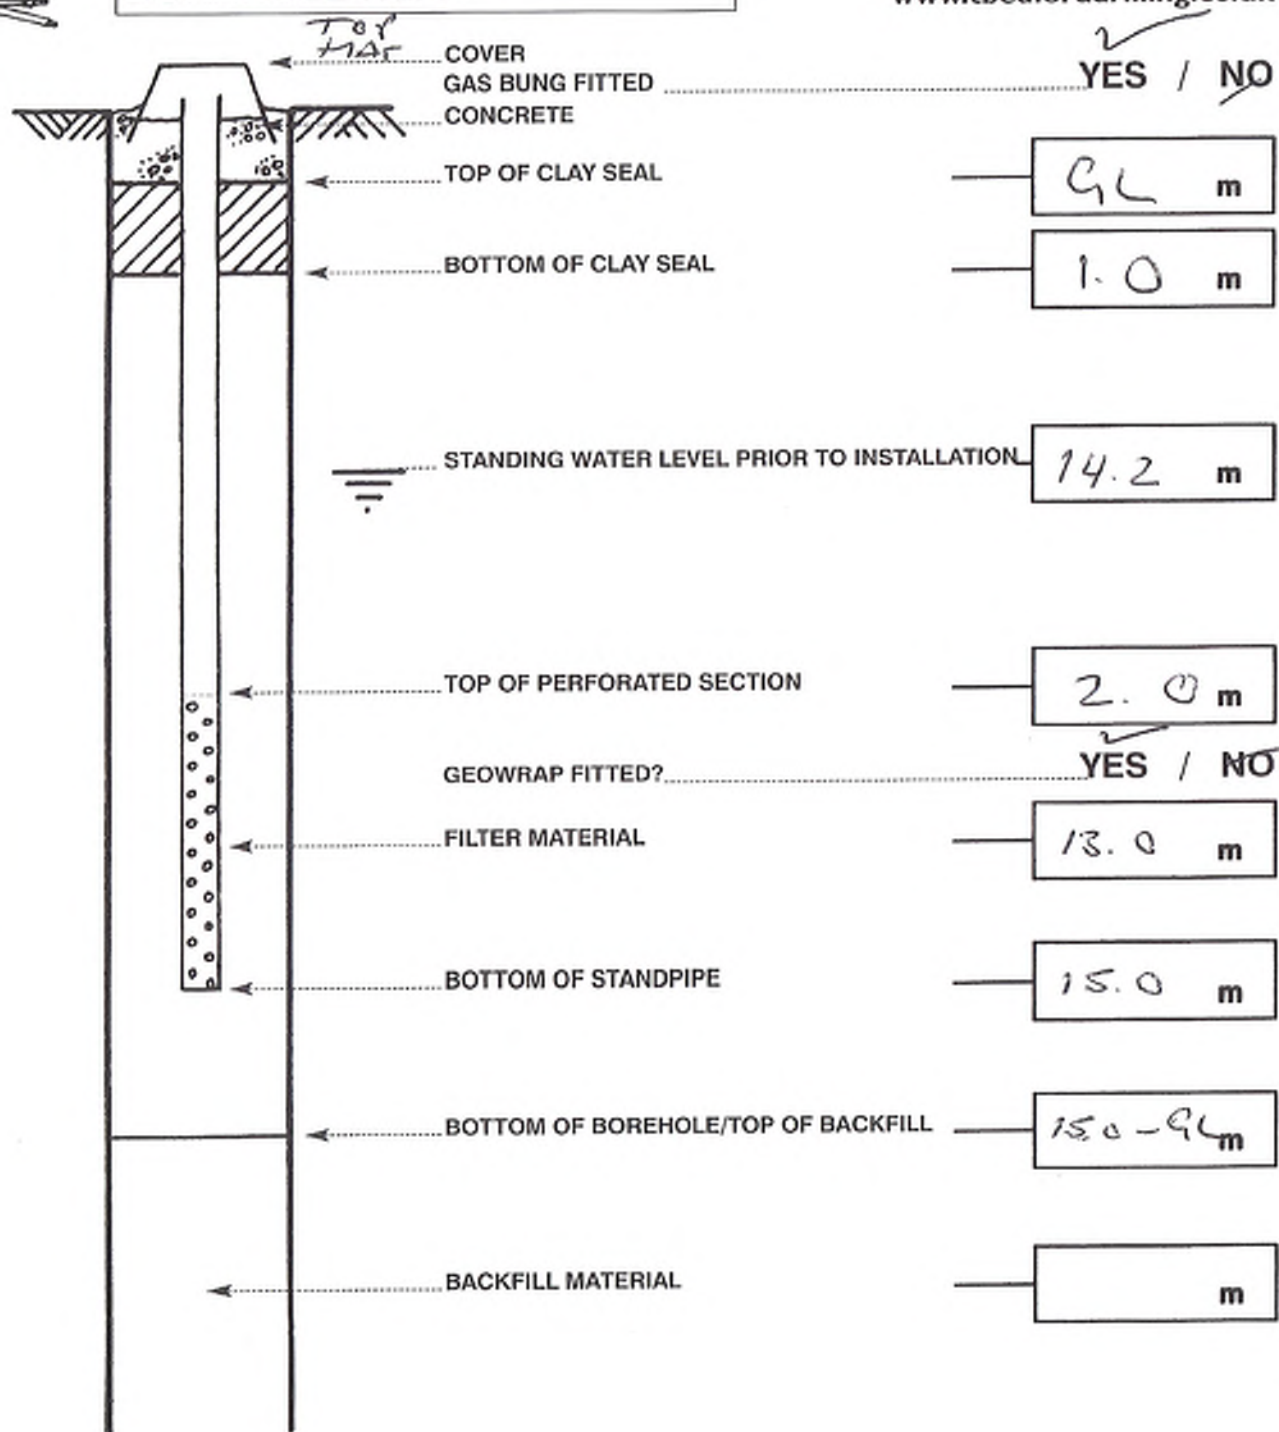

DRILLERS COMMENTS: _____

TONY BEDFORD

Site Investigation Drilling Specialist
11 Marconi Drive, Yaxley, Peterborough PE7 3ZR
Tel: 01733 242866 Mobile: 07860 514387

SITE NAME, ADDRESS, JOB NUMBER

BOREHOLE NO.

(M) T W Th F S Su 17 18 19

Campelesham

6

DISTURBED SAMPLES U4

UNDISTURBED SAMPLES U1

PENETRATION TESTS

SPT SPT

GROUND CONDITIONS ENCOUNTERED

| from | to | consistency or density / colour / type |
|---|------|--|
| GL | 0.4 | Brown silty sand + gravel |
| 0.4 | 8.1 | Orange/brown sand with occasional gravel |
| 8.1 | 15.0 | Sand + gravel. |
| * 1.5hrs claywork fetching water. | | |
| * 1hr chiselling large boulders from 11.1 - 11.4. | | |

| no. | depth |
|------|-------|
| D 1 | |
| D 2 | |
| D 3 | |
| D 4 | |
| D 5 | |
| D 6 | |
| D 7 | |
| D 8 | |
| D 9 | |
| D 10 | |
| D 11 | |
| D 12 | |
| D 13 | |
| D 14 | |
| D 15 | |
| D 16 | |
| D 17 | |
| D 18 | |
| D 19 | |
| D 20 | |

| no. | depth | length | blows |
|------|-------|--------|-------|
| U 1 | | | |
| U 2 | | | |
| U 3 | | | |
| U 4 | | | |
| U 5 | | | |
| U 6 | | | |
| U 7 | | | |
| U 8 | | | |
| U 9 | | | |
| U 10 | | | |
| U 11 | | | |
| U 12 | | | |
| U 13 | | | |
| U 14 | | | |
| U 15 | | | |

| type/no | depth | 150 | 75 | 75 | 75 | 75 |
|---------|-------|-----|----|----|----|----|
| S/C 1 | | | | | | |
| S/C 2 | | | | | | |
| S/C 3 | | | | | | |
| S/C 4 | | | | | | |
| S/C 5 | | | | | | |
| S/C 6 | | | | | | |
| S/C 7 | | | | | | |
| S/C 8 | | | | | | |
| S/C 9 | | | | | | |
| S/C 10 | | | | | | |
| S/C 11 | | | | | | |
| S/C 12 | | | | | | |
| S/C 13 | | | | | | |
| S/C 14 | | | | | | |
| S/C 15 | | | | | | |

BULK SAMPLES

| no. | from | to |
|------|------|----|
| B 1 | | |
| B 2 | | |
| B 3 | | |
| B 4 | | |
| B 5 | | |
| B 6 | | |
| B 7 | | |
| B 8 | | |
| B 9 | | |
| B 10 | | |
| B 11 | | |

DETAILS OF GROUNDWATER ENCOUNTERED

| | | | |
|---------------------------------|---|---|-----|
| depth struck | | | |
| casing depth | | | |
| inflow rate | | | |
| rose to | | | |
| sealed out at | | | |
| sample no. | w | w | w |
| sample depth | | | |
| water level at start of boring | | | 321 |
| water level at finish of boring | | | 15 |
| water level when casing removed | | | |

CHISEL OR PIT

| | | |
|-------------------------|-------|-------------------------------------|
| Borehole complete | Yes | <input checked="" type="radio"/> No |
| Depth of borehole cased | 15.0 | |
| Piezometer / Standpipe? | depth | |

| | | |
|-------|------|--|
| from | 11.1 | |
| to | 11.4 | |
| hours | 1 | |

DRILLERS COMMENTS

DETAILS OF WATER ADDED

| | | |
|--|--|--|
| | | |
| | | |
| | | |

| | | |
|--------|------|--|
| from | 1.2 | |
| to | 15.0 | |
| litres | 850 | |

driller *A. A.*

STANDPIPE INSTALLATION

SITE *CC12-2001/100*

DATE *18/09/18*

DRILLER *A. J. Kelly*

BOREHOLE No. *B.*

T. BEDFORD

Site Investigation Drilling Specialist

11 Marconi Drive
Yaxley

Peterborough

PE7 3ZR


Tel: (01733) 242866

Fax: (01733) 242496

VAT No: 396/0636/26

tony.bedford@tesco.net

www.thebedforddrilling.co.uk

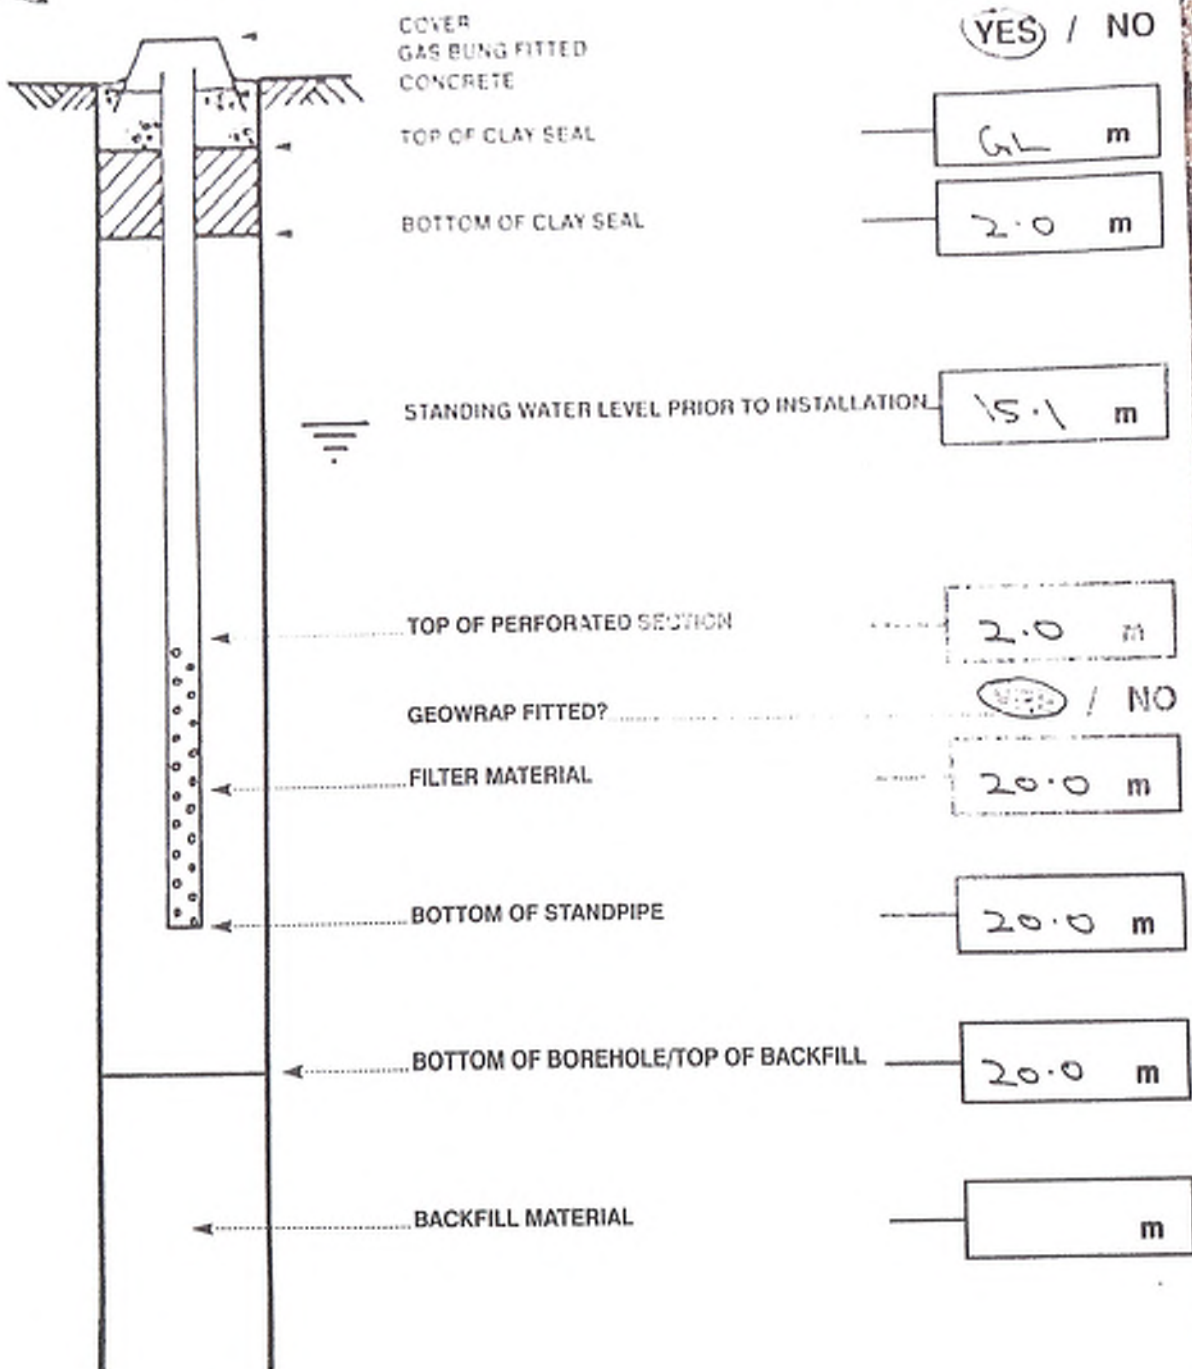

DRILLERS COMMENTS: _____

TONY BEDFORD

Site Investigation Drilling Specialist
 11 Marconi Drive, Yaxley, Peterborough PE7 3ZR
 Tel: 01733 242866 Mobile: 07860 514387

SITE NAME, ADDRESS, JOB NUMBER

BOREHOLE NO.

(M) T W Th F S Su 17 9 18

CRIPPLESTON

C

DISTURBED SAMPLES U4

UNDISTURBED SAMPLES U4

PENETRATION TESTS

SPT SPT

GROUND CONDITIONS ENCOUNTERED

| from | to | consistency or density / colour / type |
|-------|------|--|
| GL | 1.1 | BROWN GRAVELLY SAND |
| 1.1 | 8.8 | BROWN SAND |
| 8.8 | 9.1 | BROWN SAND v GRAVEL |
| 9.1 | 14.4 | BROWN SAND |
| 14.4 | 15.0 | BROWN SAND v GRAVEL |
| 1 1/2 | | WATER FEELING WATER FOR DRILLING |
| | | LOSE SITE TO GET MORE CASING. |

| no. | depth |
|------|-------|
| D 1 | |
| D 2 | |
| D 3 | |
| D 4 | |
| D 5 | |
| D 6 | |
| D 7 | |
| D 8 | |
| D 9 | |
| D 10 | |
| D 11 | |
| D 12 | |
| D 13 | |
| D 14 | |
| D 15 | |
| D 16 | |
| D 17 | |
| D 18 | |
| D 19 | |
| D 20 | |

| no. | depth | length | blows |
|------|-------|--------|-------|
| U 1 | | | |
| U 2 | | | |
| U 3 | | | |
| U 4 | | | |
| U 5 | | | |
| U 6 | | | |
| U 7 | | | |
| U 8 | | | |
| U 9 | | | |
| U 10 | | | |
| U 11 | | | |
| U 12 | | | |
| U 13 | | | |
| U 14 | | | |
| U 15 | | | |

| type/no | depth | 150 | 75 | 75 | 75 | 75 |
|---------|-------|-----|----|----|----|----|
| S/C 1 | | | | | | |
| S/C 2 | | | | | | |
| S/C 3 | | | | | | |
| S/C 4 | | | | | | |
| S/C 5 | | | | | | |
| S/C 6 | | | | | | |
| S/C 7 | | | | | | |
| S/C 8 | | | | | | |
| S/C 9 | | | | | | |
| S/C 10 | | | | | | |
| S/C 11 | | | | | | |
| S/C 12 | | | | | | |
| S/C 13 | | | | | | |
| S/C 14 | | | | | | |
| S/C 15 | | | | | | |

BULK SAMPLES

| no. | from | to |
|------|------|----|
| B 1 | | |
| B 2 | | |
| B 3 | | |
| B 4 | | |
| B 5 | | |
| B 6 | | |
| B 7 | | |
| B 8 | | |
| B 9 | | |
| B 10 | | |
| B 11 | | |

DETAILS OF GROUNDWATER ENCOUNTERED

| | | | |
|---------------------------------|---|---|-----|
| depth struck | | | |
| casing depth | | | |
| inflow rate | | | |
| rose to | | | |
| sealed out at | | | |
| sample no. | w | w | w |
| sample depth | | | |
| water level at start of boring | | | DEM |
| water level at finish of boring | | | DEM |
| water level when casing removed | | | |

CHISEL OR PIT

| | | |
|-------------------------|-------|------|
| Borehole complete | Yes | (No) |
| Depth of borehole cased | 15.0 | |
| Piezometer / Standpipe? | depth | |

| | |
|-------|-------|
| from | GL |
| to | 1.2 |
| hours | 1 1/4 |

DRILLERS COMMENTS

DETAILS OF WATER ADDED

| |
|--|
| |
| |
| |

| | | |
|--------|-------------|--|
| from | 1.2 | |
| to | 15.0 | |
| litres | 150 GALLONS | |

driller K DAUGH



STANDPIPE INSTALLATION

SITE CRIMPISHAM

DATE 18-9-12

DRILLER KIDAVEN

BOREHOLE No. C

T. BEDFORD

Site Investigation Drilling Specialist

11 Marconi Drive

Yaxley

Peterborough

PE7 3ZR


Tel: (01733) 242866

Fax: (01733) 242496

VAT No: 396/0636/26

tony.bedford@tesco.net

www.tbedforddrilling.co.uk

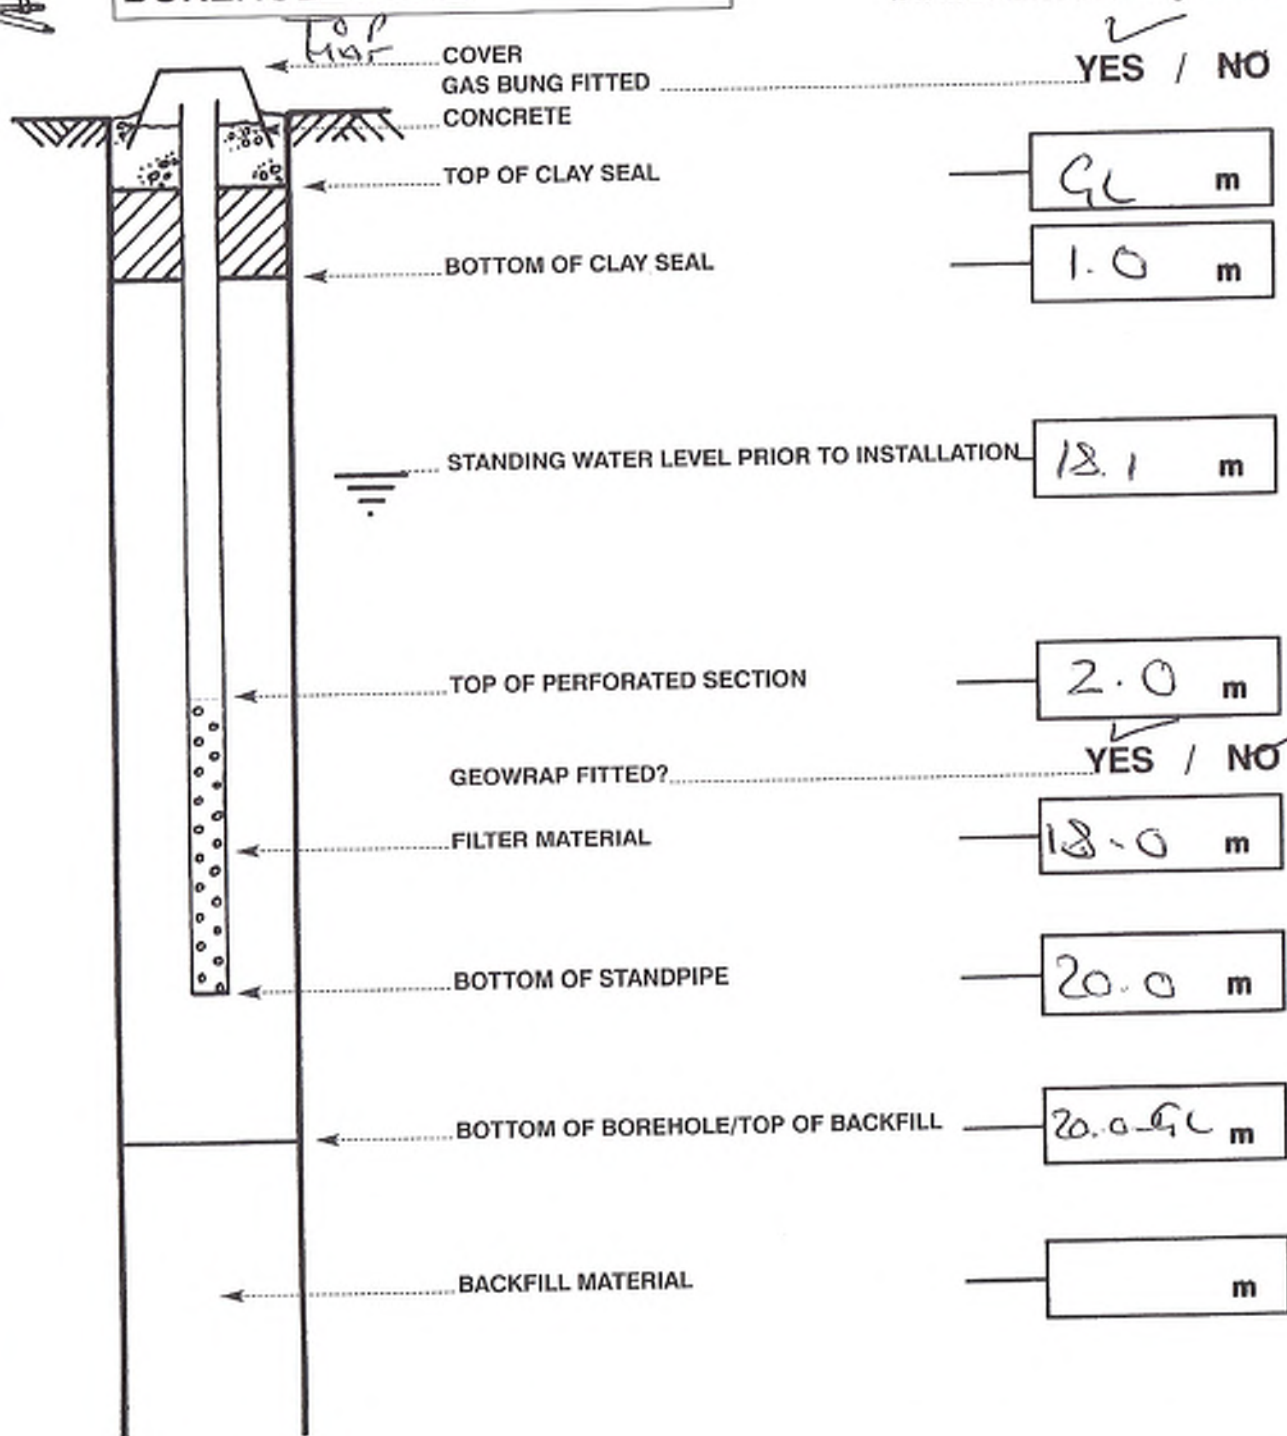

DRILLERS COMMENTS:

TONY BEDFORD

Site Investigation Drilling Specialist
11 Marconi Drive, Yaxley, Peterborough PE7 3ZR
Tel: 01733 242866 Mobile: 07860 514387

SITE NAME, ADDRESS, JOB NUMBER

BOREHOLE NO.

M T W Th **F** S Su 14 9 18

CRIMPLESHAM

D

DISTURBED SAMPLES U4

UNDISTURBED SAMPLES U4

PENETRATION TESTS

SPT SPT W C

GROUND CONDITIONS ENCOUNTERED

| from | to | consistency or density / colour / type | no. | depth |
|------|------|--|------|-------|
| GL | 2.1 | BROWN SAND CLAY | D 1 | 6.0 |
| | | GRAVEL | D 2 | 9.0 |
| 2.1 | 6.6 | OFF WHITE CHUCK | D 3 | |
| | | | D 4 | |
| 6.6 | 8.3 | MOTTLED CHUCK MARL | D 5 | |
| | | | D 6 | |
| 8.3 | 11.0 | GREEN CLAY | D 7 | |
| | | | D 8 | |
| | | | D 9 | |
| | | | D 10 | |
| | | | D 11 | |
| | | | D 12 | |
| | | | D 13 | |
| | | | D 14 | |
| | | | D 15 | |
| | | | D 16 | |
| | | | D 17 | |
| | | | D 18 | |
| | | | D 19 | |
| | | | D 20 | |

| no. | depth | length | blows |
|------|-------|--------|-------|
| U 1 | | | |
| U 2 | | | |
| U 3 | | | |
| U 4 | | | |
| U 5 | | | |
| U 6 | | | |
| U 7 | | | |
| U 8 | | | |
| U 9 | | | |
| U 10 | | | |
| U 11 | | | |
| U 12 | | | |
| U 13 | | | |
| U 14 | | | |
| U 15 | | | |

| type/no | depth | 150 | 75 | 75 | 75 | 75 |
|---------|-------|-----|----|----|----|----|
| S/C 1 | | | | | | |
| S/C 2 | | | | | | |
| S/C 3 | | | | | | |
| S/C 4 | | | | | | |
| S/C 5 | | | | | | |
| S/C 6 | | | | | | |
| S/C 7 | | | | | | |
| S/C 8 | | | | | | |
| S/C 9 | | | | | | |
| S/C 10 | | | | | | |
| S/C 11 | | | | | | |
| S/C 12 | | | | | | |
| S/C 13 | | | | | | |
| S/C 14 | | | | | | |
| S/C 15 | | | | | | |

BULK SAMPLES

| no. | from | to |
|------|------|----|
| B 1 | | |
| B 2 | | |
| B 3 | | |
| B 4 | | |
| B 5 | | |
| B 6 | | |
| B 7 | | |
| B 8 | | |
| B 9 | | |
| B 10 | | |
| B 11 | | |

DETAILS OF GROUNDWATER ENCOUNTERED

| | | | |
|---------------------------------|-----------|---|------|
| depth struck | 7.2 | | |
| casing depth | 6.5 | | |
| inflow rate | FAST | | |
| rose to | 6.6 | | |
| sealed out at | 8.3 | | |
| sample no. | W | W | W |
| sample depth | NO SAMPLE | | |
| water level at start of boring | | | 0.2m |
| water level at finish of boring | | | 0.2m |
| water level when casing removed | | | 8.9 |

CHISEL OR PIT

| | | | | |
|-------------------------|-------|------|-------|-----|
| Borehole complete | Yes | No | from | GL |
| Depth of borehole cased | 9.0 | | to | 1.2 |
| Piezometer Standpipe? | depth | 11.0 | hours | 1 |

DRILLERS COMMENTS

| |
|--|
| |
| |
| |

DETAILS OF WATER ADDED

| | |
|--------|-----------|
| from | JUST |
| to | SPRINKLER |
| litres | |

driller K. DAVEN

STANDPIPE INSTALLATION

SITE *CRIMPLESHAM*

DATE *14-9-13*

DRILLER *K DAVEN*

BOREHOLE No. *D*

T. BEDFORD

Site Investigation Drilling Specialist

11 Marconi Drive

Yaxley

Peterborough

PE7 3ZR


Tel: (01733) 242866

Fax: (01733) 242496

VAT No: 396/0636/26

tony.bedford@tesco.net

www.tbedforddrilling.co.uk

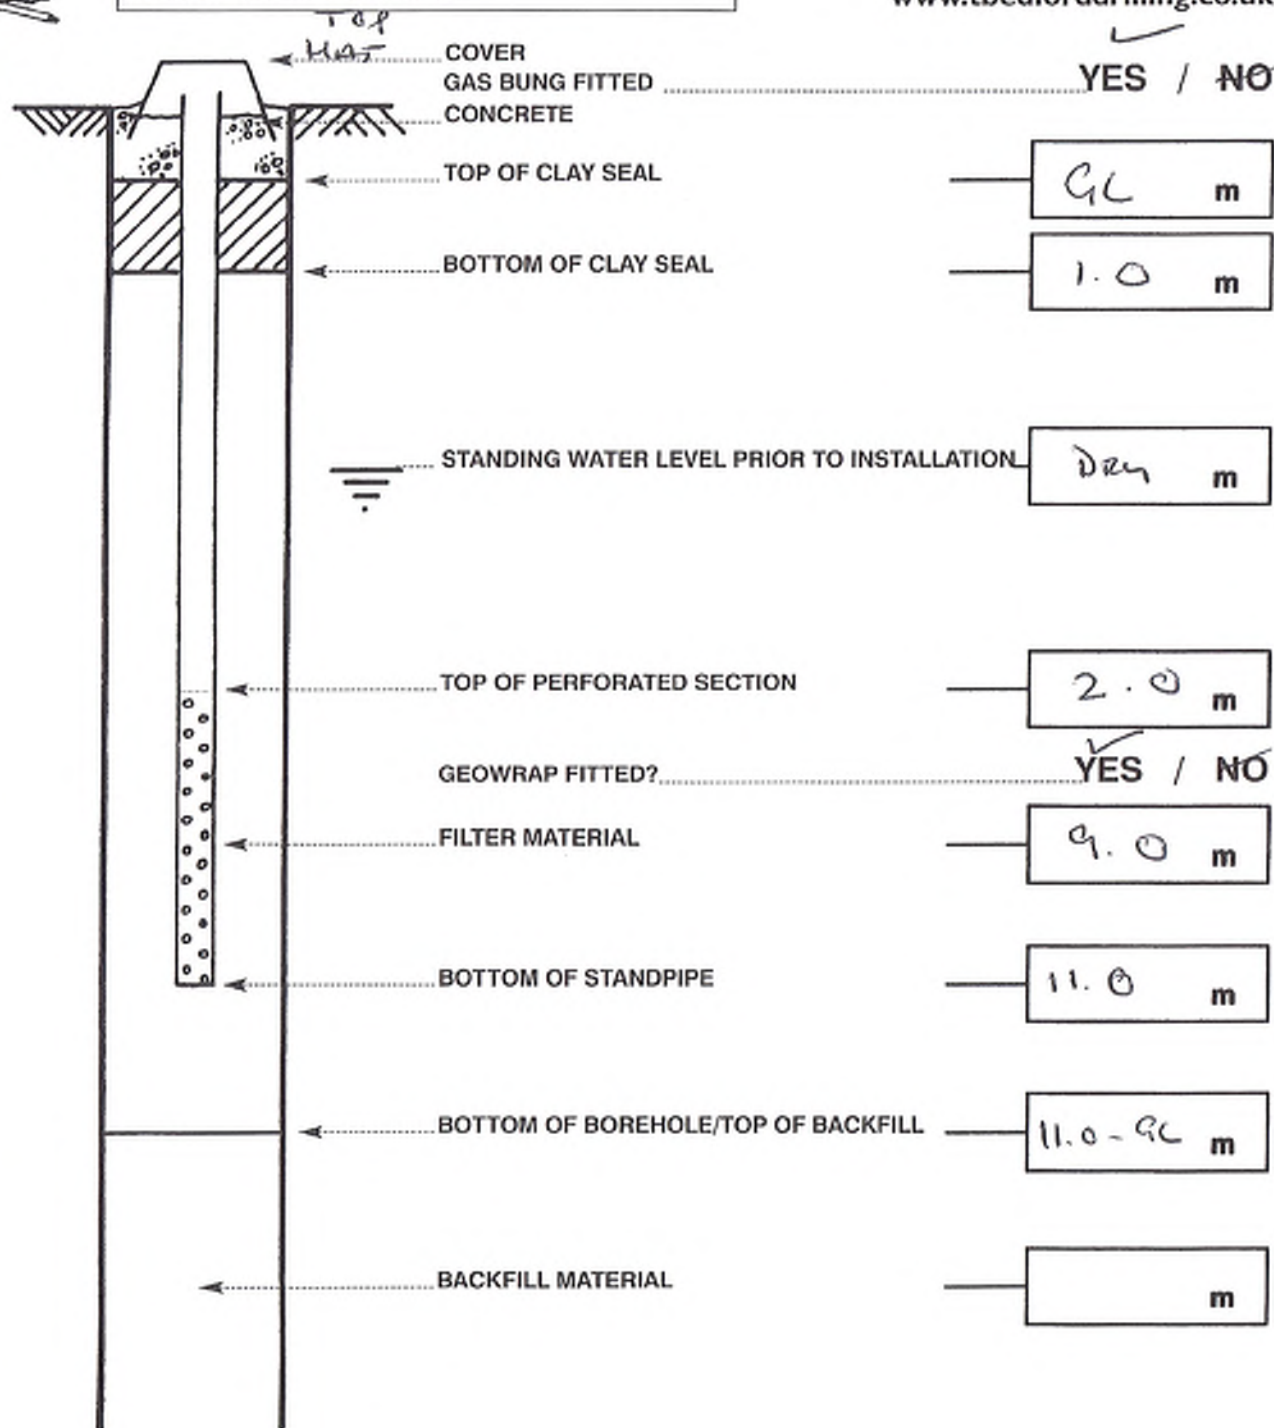

DRILLERS COMMENTS: _____

TONY BEDFORD

Site Investigation Drilling Specialist
11 Marconi Drive, Yaxley, Peterborough PE7 3ZR
Tel: 01733 242866 Mobile: 07860 514387

SITE NAME, ADDRESS, JOB NUMBER

BOREHOLE NO.

M T W Th F S Su 13 14 15 16 17 18

CRIMPUSHAM

1

DISTURBED SAMPLES U4

UNDISTURBED SAMPLES U4

PENETRATION TESTS

SPT SPT

GROUND CONDITIONS ENCOUNTERED

| from | to | consistency or density / colour / type |
|------|------|--|
| GL | 0.3 | BROWN SANDY GRAVEL CLAY |
| 0.3 | 0.6 | BROWN & WHITE CRUMBLY CHUCKY CLAY |
| 0.6 | 5.4 | OFF WHITE CHUCK |
| 5.4 | 7.4 | MOTTLED CHUCK MUD |
| 7.4 | 14.0 | Grey CLAY |

| no. | depth |
|------|-------|
| D 1 | 5.4 |
| D 2 | 12.0 |
| D 3 | |
| D 4 | |
| D 5 | |
| D 6 | |
| D 7 | |
| D 8 | |
| D 9 | |
| D 10 | |
| D 11 | |
| D 12 | |
| D 13 | |
| D 14 | |
| D 15 | |
| D 16 | |
| D 17 | |
| D 18 | |
| D 19 | |
| D 20 | |

| no. | depth | length | blows |
|------|-------|--------|-------|
| U 1 | | | |
| U 2 | | | |
| U 3 | | | |
| U 4 | | | |
| U 5 | | | |
| U 6 | | | |
| U 7 | | | |
| U 8 | | | |
| U 9 | | | |
| U 10 | | | |
| U 11 | | | |
| U 12 | | | |
| U 13 | | | |
| U 14 | | | |
| U 15 | | | |

| type/no | depth | 150 | 75 | 75 | 75 |
|---------|-------|-----|----|----|----|
| S/C 1 | | | | | |
| S/C 2 | | | | | |
| S/C 3 | | | | | |
| S/C 4 | | | | | |
| S/C 5 | | | | | |
| S/C 6 | | | | | |
| S/C 7 | | | | | |
| S/C 8 | | | | | |
| S/C 9 | | | | | |
| S/C 10 | | | | | |
| S/C 11 | | | | | |
| S/C 12 | | | | | |
| S/C 13 | | | | | |
| S/C 14 | | | | | |
| S/C 15 | | | | | |

BULK SAMPLES

| no. | from | to |
|------|------|----|
| B 1 | | |
| B 2 | | |
| B 3 | | |
| B 4 | | |
| B 5 | | |
| B 6 | | |
| B 7 | | |
| B 8 | | |
| B 9 | | |
| B 10 | | |
| B 11 | | |

DETAILS OF GROUNDWATER ENCOUNTERED

| | | | |
|---------------------------------|-----|---|---|
| depth struck | | | |
| casing depth | | | |
| inflow rate | | | |
| rose to | | | |
| sealed out at | | | |
| sample no. | w | w | w |
| sample depth | | | |
| water level at start of boring | DRY | | |
| water level at finish of boring | DRY | | |
| water level when casing removed | DRY | | |

CHISEL OR PIT

| | | |
|-------------------------|-------|------|
| Borehole complete | Yes | No |
| Depth of borehole cased | 7.5 | |
| Piezometer / Standpipe | depth | 14.0 |

| | |
|-------|-----|
| from | GL |
| to | 1.2 |
| hours | 1 |

DRILLERS COMMENTS

DETAILS OF WATER ADDED

| |
|--|
| |
| |
| |

| | |
|--------|-----------|
| from | JUSS |
| to | SPLASHISS |
| litres | |

driller KIDAU



LET'S
0.1-
SHALL

STANDPIPE INSTALLATION

SITE *Crimpsman*

DATE *14. - 9 - 18*

DRILLER *K. DAVEN*

BOREHOLE No. *2*

T. BEDFORD

Site Investigation Drilling Specialist

11 Marconi Drive

Yaxley

Peterborough

PE7 3ZR


Tel: (01733) 242866

Fax: (01733) 242496

VAT No: 396/0636/26

tony.bedford@tesco.net

www.tbedforddrilling.co.uk

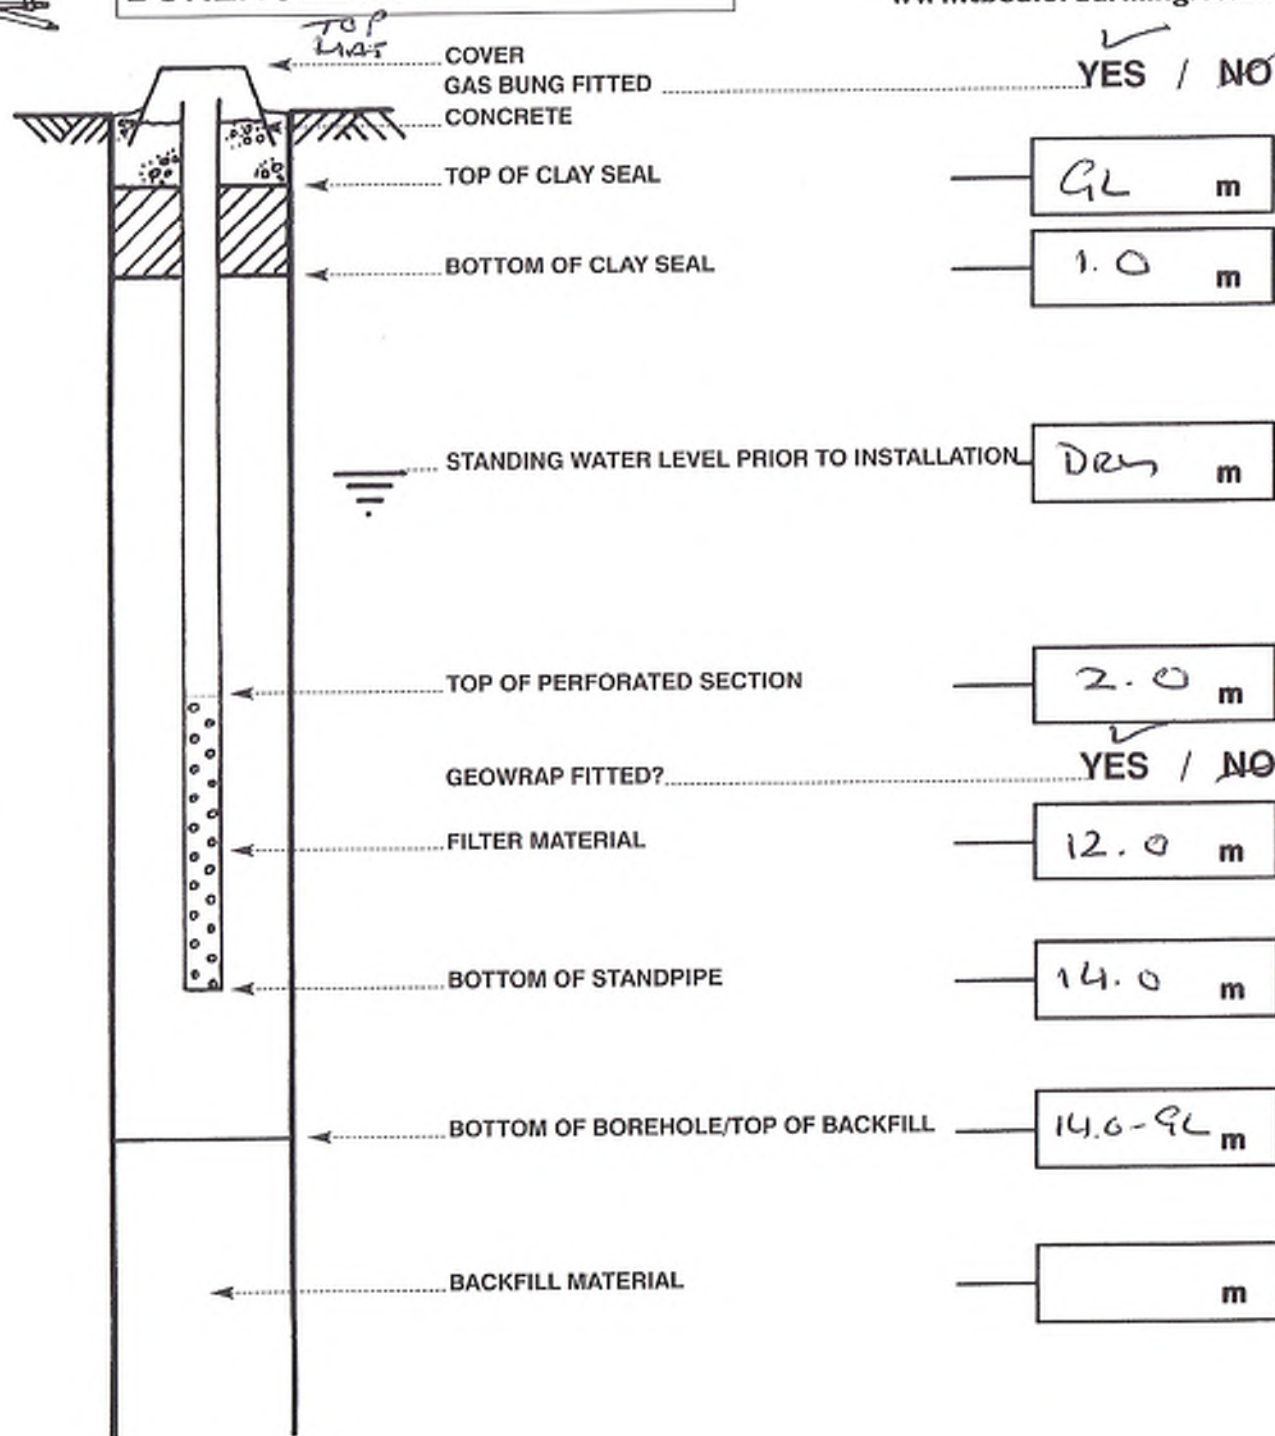

DRILLERS COMMENTS: _____

TONY BEDFORD

Site Investigation Drilling Specialist
11 Marconi Drive, Yaxley, Peterborough PE7 3ZR
Tel: 01733 242866 Mobile: 07860 514387

SITE NAME, ADDRESS, JOB NUMBER

BOREHOLE NO.

M T W **Th** F S Su 13 9 18

CRIMPLESMAN

F

DISTURBED SAMPLES U4

UNDISTURBED SAMPLES U4

PENETRATION TESTS

SPT SPT W C

GROUND CONDITIONS ENCOUNTERED

| from | to | consistency or density / colour / type |
|---------------------------------------|------|--|
| 0.0 | 1.2 | BROWN FLINT GRAVELLY CLAY |
| 1.2 | 2.1 | BROWN & WHITE CHALKY FLINT GRAVELLY CLAY |
| 2.1 | 7.2 | WHITE CHALK |
| 7.2 | 10.5 | Green chalk MARLS |
| 10.5 | 12.0 | Green CLAY |
| 8 TO 10.30 INDUCTION AND INTRODUCTION | | |

| no. | depth |
|------|-------|
| D 1 | 7.5 |
| D 2 | 10.5 |
| D 3 | |
| D 4 | |
| D 5 | |
| D 6 | |
| D 7 | |
| D 8 | |
| D 9 | |
| D 10 | |
| D 11 | |
| D 12 | |
| D 13 | |
| D 14 | |
| D 15 | |
| D 16 | |
| D 17 | |
| D 18 | |
| D 19 | |
| D 20 | |

| no. | depth | length | blows |
|------|-------|--------|-------|
| U 1 | | | |
| U 2 | | | |
| U 3 | | | |
| U 4 | | | |
| U 5 | | | |
| U 6 | | | |
| U 7 | | | |
| U 8 | | | |
| U 9 | | | |
| U 10 | | | |
| U 11 | | | |
| U 12 | | | |
| U 13 | | | |
| U 14 | | | |
| U 15 | | | |

| type/no | depth | 150 | 75 | 75 | 75 | 75 |
|---------|-------|-----|----|----|----|----|
| S/C 1 | | | | | | |
| S/C 2 | | | | | | |
| S/C 3 | | | | | | |
| S/C 4 | | | | | | |
| S/C 5 | | | | | | |
| S/C 6 | | | | | | |
| S/C 7 | | | | | | |
| S/C 8 | | | | | | |
| S/C 9 | | | | | | |
| S/C 10 | | | | | | |
| S/C 11 | | | | | | |
| S/C 12 | | | | | | |
| S/C 13 | | | | | | |
| S/C 14 | | | | | | |
| S/C 15 | | | | | | |

BULK SAMPLES

| no. | from | to |
|------|------|----|
| B 1 | | |
| B 2 | | |
| B 3 | | |
| B 4 | | |
| B 5 | | |
| B 6 | | |
| B 7 | | |
| B 8 | | |
| B 9 | | |
| B 10 | | |
| B 11 | | |

DETAILS OF GROUNDWATER ENCOUNTERED

| | | | |
|---------------------------------|-----------|---|------|
| depth struck | 6.0 | | |
| casing depth | 5.5 | | |
| inflow rate | FAST | | |
| rose to | 4.8 | | |
| sealed out at | 9.0 | | |
| sample no. | W | W | W |
| sample depths | NO SAMPLE | | |
| water level at start of boring | | | DR |
| water level at finish of boring | | | 11.5 |
| water level when casing removed | | | 7.2 |

CHISEL OR BIT

| | | |
|------------------------------|---|-----------------------------|
| Borehole complete | <input checked="" type="checkbox"/> Yes | <input type="checkbox"/> No |
| Depth of borehole cased | 9.0 | |
| Piezometer <u>Standpipe?</u> | depth | 12.0 |

| | |
|-------|-----|
| from | GC |
| to | 1.2 |
| hours | 1 |

DRILLERS COMMENTS

| |
|--|
| |
| |
| |

DETAILS OF WATER ADDED

| from | to | litres |
|------|----|--------|
| | | |
| | | |
| | | |

driller K. DAVEN



STANDPIPE INSTALLATION

SITE CRIMPLESHAM

DATE 13-9-18

DRILLER K DAVEN

BOREHOLE No. F

T. BEDFORD

Site Investigation Drilling Specialist

11 Marconi Drive

Yaxley

Peterborough

PE7 3ZR


Tel: (01733) 242866

Fax: (01733) 242496

VAT No: 396/0636/26

tony.bedford@tesco.net

www.tbedforddrilling.co.uk

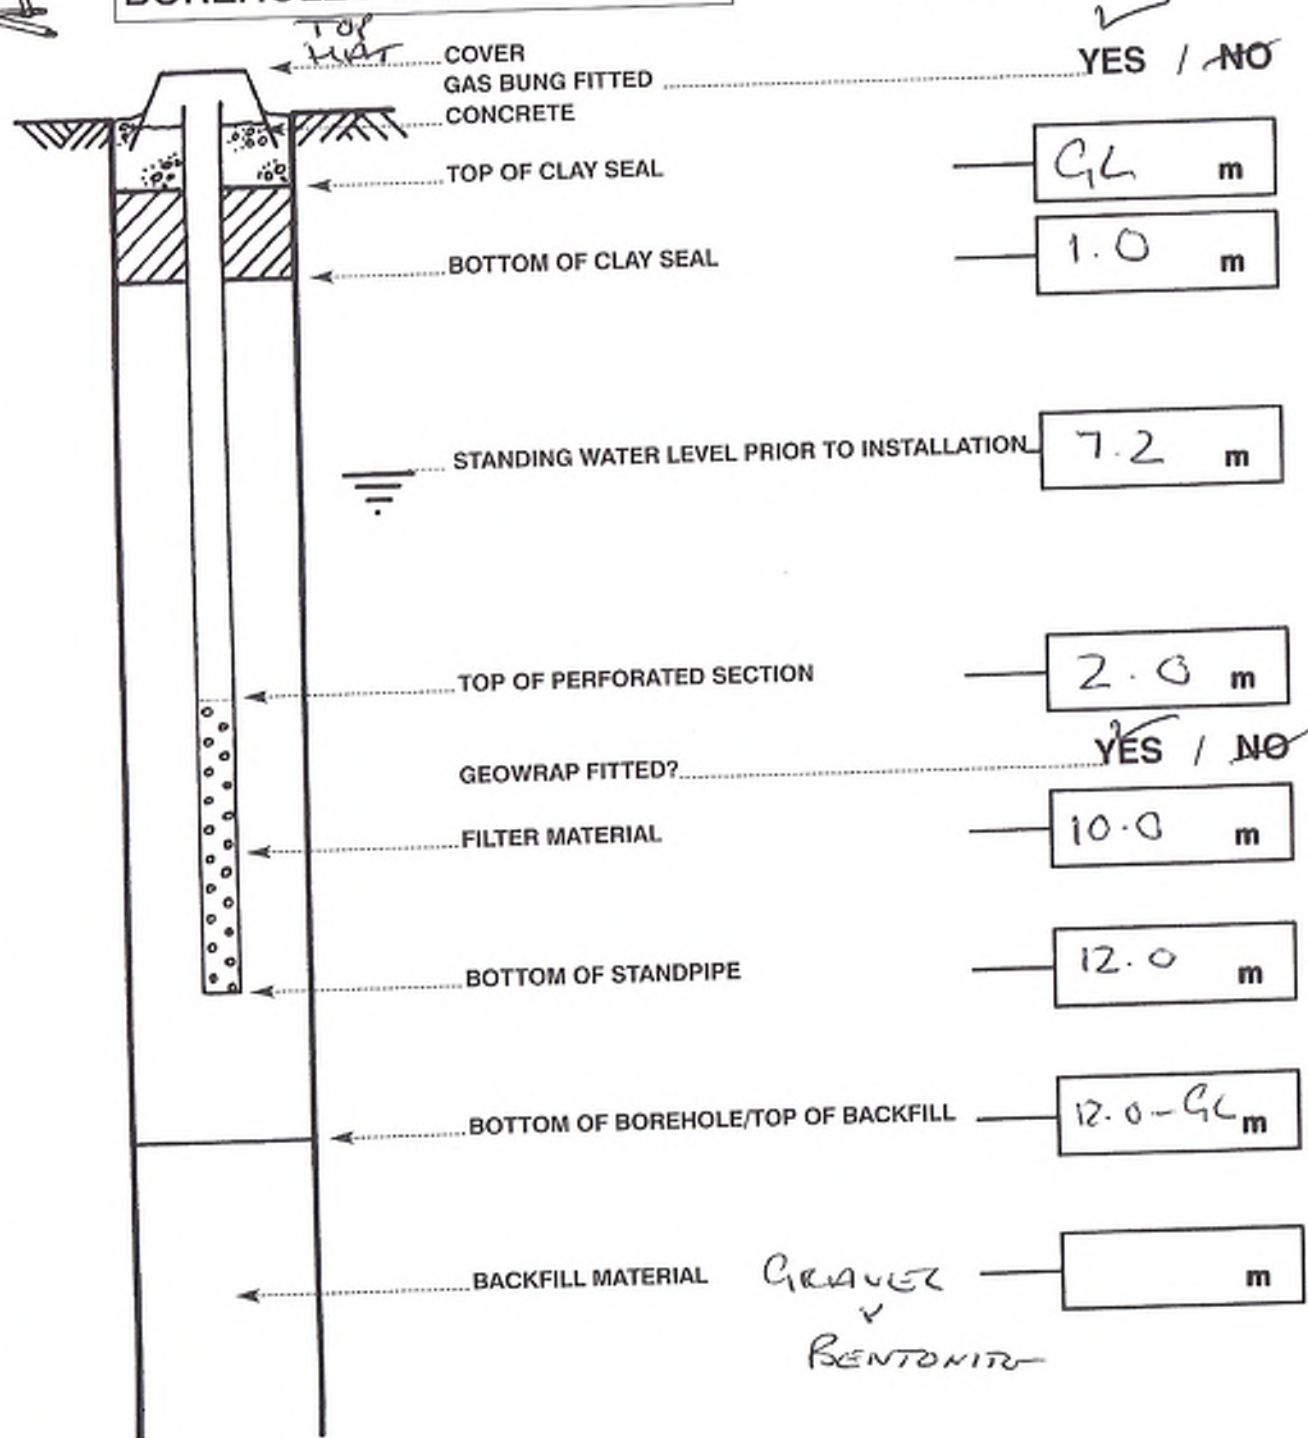

DRILLERS COMMENTS:

